


# Field Report

201020075

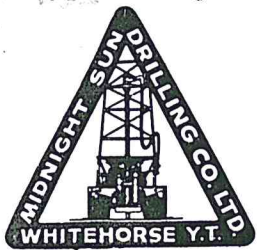

PH. 633-3070 TELEX 036-8496  
P.O. BOX 4391  
WHITEHORSE, YUKON

Started June 18...1991

Completed June 19...1991

NAME AND ADDRESS OF CLIENT	DESCRIPTION OF WORK	LOCATION OF WORK
Town of Watson Lake	Water Well	Ski Hill Watson Lake
	91-1A-11	

FORMATION LOG			DESCRIPTION OF WORK	TIME			
FROM	TO	FORMATION		DATE	FROM	TO	HOURS
			MOVE				
			MOVE set up	June 18	6:30	7:30	1
0	9	Gr.	sand silt	"	7:30	8:30	1
9	15	silt	sand Gr.				
15	17	sand	Gr. silt				
17	20	Till					
20	29	Till		June 19	7:30	11:00	3.5
29	46	silt	sand Gr.				
46	69	till					
69	73	BR.					
			set screen	"	11:00	12:00	1
			Develop	"	12:00	2:30	2.5
			move off	"	2:30	3:30	1
			Fix fan belt on #59	"	3:30	4:30	1

rd. of Casing & Pipe				Remarks:
Size	Type	Size	Type	
6				3 GPM.
Feet	Inch	Feet	Inch	1- Odex shoe
71	6			25 slot screen
				K Packer
				5 7/8" bit pin
				73' screen bottom
				Static Level
				Ground Level 54' and rising
				Top Of Casing
				Total Rig Time hrs.
				Total Standby hrs.
				Drilling Mud sacks

SIGNATURES

MIDNIGHT SUN.....  
TITLE.....

CLIENT *Mark Robinson*  
TITLE..... P.O. # 004217